

Manhole Inspection Summary

Manhole # **S31E__018MH**

Printed On: 4/8/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **31E** Node: **018** Status: **Found**

Insp Date: **3/28/08 2:28 PM**

Incomplete Comments

Crew: **ads3**
Inspector: **ADS1**
Firm: **ADS**

Location Address: **224 GREENE ST** Cross Street: **SARATOGA ST**

Manhole Type: **Junction** Location: **Roadway** Ground Conditions: **Dry**
☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
75

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **1** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Flat top**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Rectangular** Diameter: **42** (in.) Length: **40** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps Count: **7** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



Top View

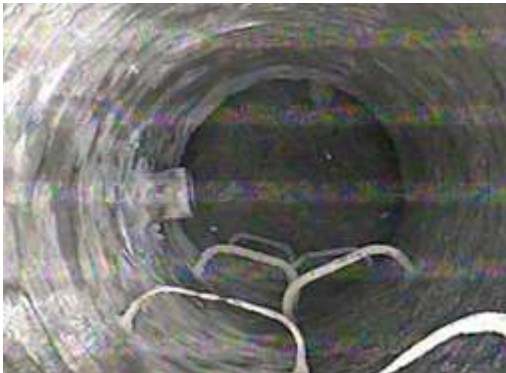

Top View

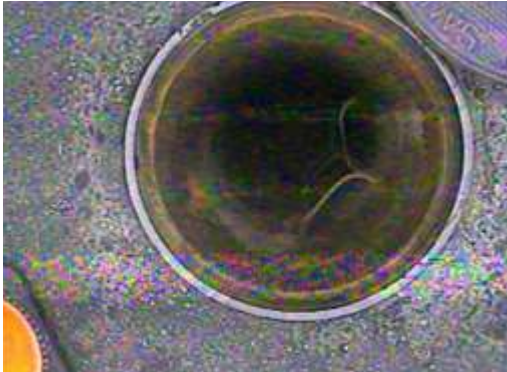

FRAME OFFSET

Manhole Inspection Summary

Manhole # S31E__018MH

Printed On: 4/8/2009

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: (in.) Direct
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **10.70** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☐ Gravy ☒ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent: **Light**
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer
Pipe In @ 7 O'Clock

7 O'Clock Inflow



Pipe Height: (in.) Direct
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **8.93** (ft.) Flow Characteristics: **None**
Deposits: ☒ None ☐ Mud ☐ Gravy ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S31E__018MH

Printed On: 4/8/2009

Page 4 of 4

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.70** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☐ Debris ☐ Grease

Silt Depth: **3** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection